### AVMS FACILITIES

ACV Function	4920M	4920		
Voltage (8 ranges)	100mV - 1100V	90mV - 1100V		
Frequency range	10Hz - 1MHz	1Hz - 1.25MHz		
Input(s)	N Type	N (A) or 4mm posts (B)		
Spot Calibration ?	NO	YES		
Transfer Mode (AC-DC)	NO	YES		
MilliVolt option	NO	0.9mV - 110mV		
WBV Function	4920M	4920		
Voltage	2 ranges 0.1 - 3.5V	One range 0.9 - 3.5V		
Frequency range	10Hz - 20MHz	10Hz - 50MHz		
Input	N Type	N type on remote unit		

### ACV Input impedance:

 $3 \, \text{mV} - 1 \, \text{V}$  ranges =  $404 \, \text{K} \Omega$  shunted by  $90 \, \text{pF}$ 

3V - 100V ranges =  $124K\Omega$  shunted by 150pF

300V & 1KV ranges =  $404 \text{K}\Omega$  shunted by 90 pF

### WBV Input impedance:

all ranges =  $50\Omega$ 

### AVMS SPECIAL CALIBRATION SEQUENCE

•	-		_					•		
Δ	( '	v	١.		2	^	٠	1	on	
n	_	•		u		•	•		~ 11	

(N = Normal cal mode, S = Special Cal mode

Cal type	AVMS Range	Input	freq	Cal Menu
Frequency	1 or 10V	100%	1 E 6	N, Freq
Filter Cal	1 O V	6 V	1 E 3	S, Filt
30% LF Cal [1]	1 O V	3 V	1 E 3	N
100% LF Cal [1]	1 O V	10V	1 E 3	N
100% HF Cal [1,2]	1 O V	10V	1 E 6	N
Linearity High	1 0 V	10V	1 E 6	S, ALin
Linearity Mid (4920)	1 O V	3 V	1 E 6	S, ALin
Linearity Low (4920M)	10V	2 V	1 E 6	S, ALin
Linearity Low (4920)	1 O V	1 V	1 E 6	S, Aling
DC Cal High (4920)	1 0 V	±10V	DC	S, AcDo
DC Cal Low (4920)	3 V	±3 V	DC	S, ApDo
Flatness Cals	10V	10V	A, B, C, D	S, Flat
Then for all other ranges	:			
30% LF Cal [1]	Range	0.3R	1 E 3	N AAA
100% LF Cal [1]	Range	1.0R	1 E 3	N
100% HF Cal [1,2]	Range	1.0R	1 E 6	N
Flatness Cals	Range	1.0R	A, B, C, D	S, Flat

### Notes:

- 1. These are the points required for calibration during Routine Cal.
- 2. 100% HF Cal is not performed during Special cal (same as Flatness 'D').

## AVMS FLATNESS CALIBRATION FREQUENCIE

Range	Flatness Band						
	A	В	С	D			
0.3V - 10 V	Range/50KHz	Range/200KHz	Range/500KHz	Range/1MHz			
30V & 100V	Range/50KHz	Range/200KHz	19.9V/500KHz	19.9V/1MHz			
300V	Range/10KHz	Range/20KHz	Range/50KHz	Range/100KH=			
1000V	Range/10KHz	Range/20KHz	700V/500KHz	500V/100FHz			

## AVMS SPECIAL CALIBRATION SEQUENCE

WBV Function

(N = Normal cal mode, S = Special Cal mode

Cal type	AVMS Range	Input	Freq	Cal Menu
Linearity (4920M) [1]	3 V	None	N/A	S, WLin
Linearity (4920) [1,2]	3 V	None	N/A	S, ALin
30% LF Cal [3]	3 V	3 V	1 E 3	N
100% LF Cal [3]	3 V	3 V	1 E 3	N
Flatness Cal (4920M)	3 V	3 V	20MHz	S, Flat
Flatness Cal (4920)	3 V	3 V	5MHz	S, Flat
Flatness Cal (4920)	3 V	3 V	10MHz	S, Flat
Flatness Cal (4920)	3 V	3 V	30MHz	\$, Flat
Flatness Cal (4920)	3 V	1V [4]	5 0 M H z	S, Flat
30% LF Cal (4920M)	17 [5]	0.3V	1 E 3	N (1)
100% LF Cal (4920M)	1  [5]	1 V	1 E 3	N According to
Flatness Cals (4920M)	17 [5]	1 V	As ACV 1V	S, Flat

#### Notes:

- 1. Wide band linearity may be performed before frequency calibration.
- 2. On 4920, WLin is performed by selecting WBV, then special cal Alin.
- 3. Points required for Routine calibration.
- 4. 1V/50MHz as test system cannot drive 3V/50MHz.
- 5. Although the WBV connector is used for 4920M 1V Wide Band range, the input signal is routed from the WBV unit to the ACV pre-amp. Input impedance is  $50\Omega$  set in the WBV unit.

## AVMS CALIBRATION METHOD

Use characterised Calibrator?

Need super stable calibrator.

Characterisation to include load regulation.


Still need Thermal Voltage Convertor (TVC) system for wide band.

Use TVC systems for all calibrations/measurements?

Accurate - BUT:

Would take > 1 week per instrument.

So:

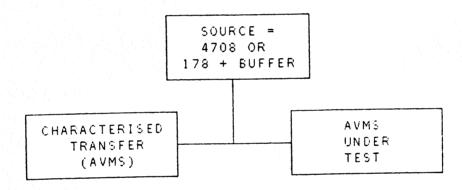

Transfer AVMS has been measured against TVC's.


Error figures used to compute Absolute ACV from source.


Use Non nominal calibration.

Losses at HF - use precision connectors and ensure tightness constant.


AC-DC Transfer - Use Accurate DC from calibrator.

DC 4 wire sense point? - approx 1uV loss in connection.

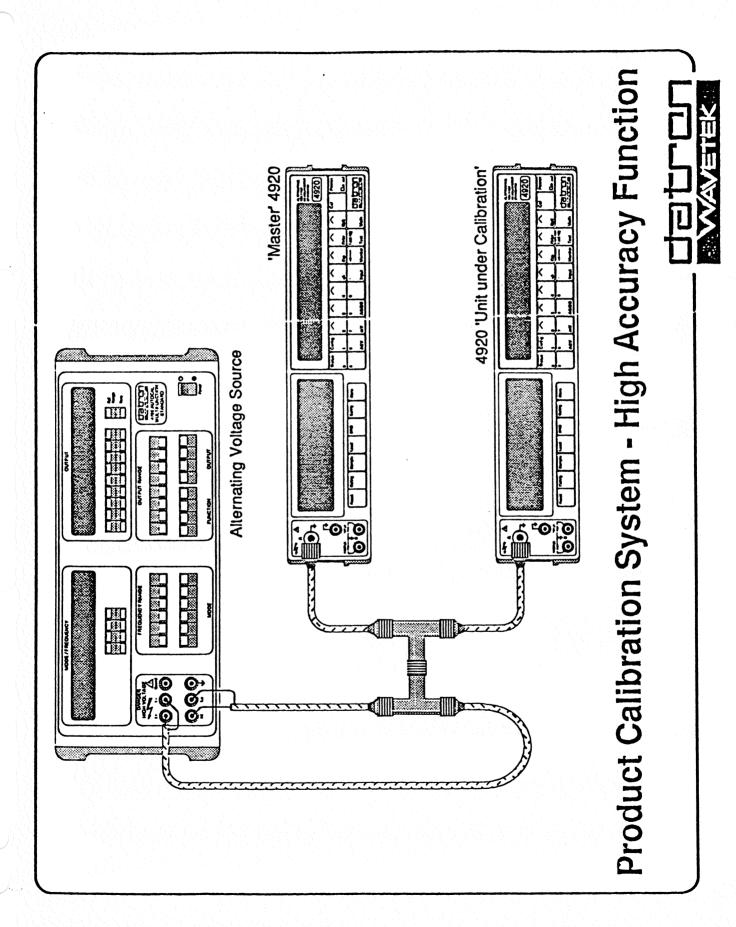

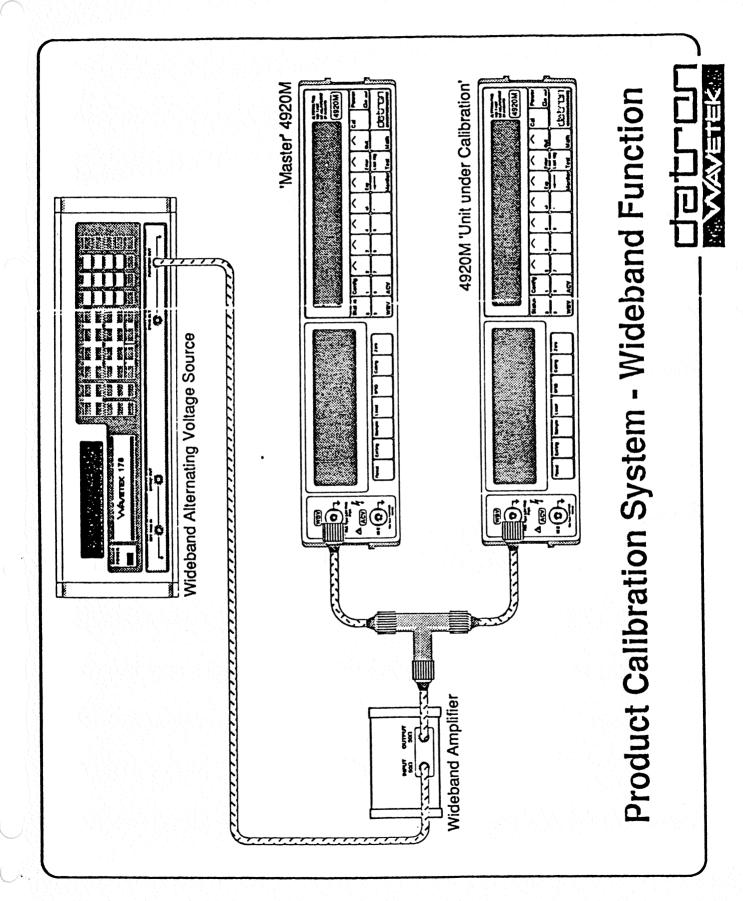

# AVMS CALIBRATE/VERIFY SEQUENCE

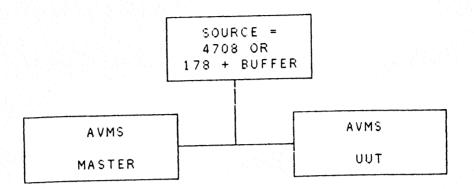

## Determine absolute source voltage

Trigger and read Master.

Apply Master error figure.

### Calibrate

Use absolute source value in "Set Cal"

### Verify Calibration

Trigger and read both AVMS.

Apply Master error figure to get absolute voltage.

Determine UUT error.

### 4920 TRANSFER

Advantage of Transfer mode

Remove Pre-Amp gain drifts.

Remove reference drifts negligible.

Can give indication of health of Cal system.

DC Cal

AC-DC difference is assumed to be range independent, DC cal on 10V range only.

10V range AC gain and linearity cals must precede DC cal.

DC cal = input +ve & -ve DC, calculate DC RMS value calculate and store AC-DC difference.

#### Transfer Measurement

Do DC+ and DC- measurement

Calculate DCRMS to get DC gain and hence AC gain using AC-DC difference

Do AC measurement

Calculate AC value from raw A-D output and calculated AC gain

### 4920 OR 4920M AS MASTER

Test system supports either 4920 or 4920M as Master.

#### 4920M Master

We have some stability data on a 4920M.

4920M wide band is proven and works to 50MHz.

4920 UUT's - Lo and earth should NOT be connected.

#### 4920 Master

ONLY 1 of 4920 UUT or 4920 Master to have Lo and earth connected.

4920 Master Lo and earth should NOT be connected for 4920M UUT.

4920 has DC capability.

User may chose to use DC accuracy from 4920 or 4708.

#### Stability audit

4920 AC-DC difference is set on 10V range.

Gain shifts on the Master AVMS will show as 4920 UUT DC errors (ex 10V). (DC gain = AC gain + AC-DC difference)

Reference drift not detected as DC cal depends on 10V AC gain cal.

If Master is 4920, make manual DC measurements to check 10V gain shift.

4920 Master DC and 4708 DC difference is compared to a warning level.

If warning level is exceeded, both results and difference
are written to "DCERRORS.RES"

## 4920 MILLIVOLTS

4 Additional Ranges 0.9mV - 110mV.

No Calibration required - but need to functionally check  $\times$  30 amp.

Do not make Transfer mV measurements as master may be 4920M.

Check LF and HF gains  $\gt$  26 &  $\lt$  32 and within 5 of each other.

Do manual accuracy checks using IVD.

## INSTALLATIONS (MANAGER)

Special verify/cal instrument

Routine verify/cal instrument

results File operations

set system Time/date

Dump cal stores

print Certificate

system Manager

eXit

Install attenuator
source of Dc traceability
make Acv flatness file
make Wbv flatness file
eXit

### DATRON WAVETEK

		Esc to Abort REPEAT F7 Procedure F9 Range F10 to Pause

### DATRON WAVETEK 4.0 Verify 4920 WBV

Version 1.2 dated 3 Apr 92

Start at: 10:15 on: 7th Apr 1992 Results in: FILE0128.RES

Comment: SYSTEM VERIFY AGAINST HOWARDS 4920

SERIAL NUMBER: 23456

Fage 1

by: 585

Transfer AVMS: 22439-3 - Due Calibration 18th May 92

Instrument under test - FIRMWARE ISSUE: 01.19 Wide Bend Option Serial Number: 23456 Instrument under test -

Test Value	Freq Hz	Pk - Pk ppm	Result	ppm Spec	Error ppm	% Error of Spec
3V RANGE,	WEV FILT	ER Off				
1.00000000	1.006	15	1.0001445V	1000	+145	+14%
3.00000000	10	32	3.0002235V	1000	+75	+7%
	1.00K	2	3.00001307	1000	+4	+0%
3.00000000	100K	5	3.00002157	1250	+7	+1%
3.00000000	1.00M	2	2.99996550	1250	-12	-1%
3.00000000		1	2.99834000	1500	-553	-37%
3.00000000	5.00M	<u> </u>	2.9971810	1500	-940	-63%
3.00000000	10.0M	_	2.9909635V	2000	-3012	-151% F
3.00000000V	20.0M	6			-5010	-50%
Z.0000000W	30.0M	2	2.9849695V	10000		
1.00000000	50.0M	23	0.9810385V	20000	-18962	-95% S

End at: 10:25 cm: 7th Apr 1992

Readings without Corrections = 0

Suspect Source Output (5) = 1

Number of Fails (F) = 1