

TPS2549-Q1 Production Silicon Change List

TinaLiang

ABSTRACT

TI discovered a bug with TPS2549-Q1 production silicon manufactured **before** March 1st, 2016. If you are using a TPS2549-Q1 device manufactured **after** March 1st, 2016, (directions follow on how to identify) please discard this change notice.

The bug is related to the CDP/SDP auto-switch function and is triggered only when the device is in CDP mode. While in CDP mode, the bug is triggered when the TPS2549-Q1 host port is connected to a compliant USB 2.0 device and high-speed data communication handshake is taking place.

The bug has no affect in systems where TPS2549-Q1 is configured in SDP/SDP1, DCP/DCP1, or Client mode (visit www.ti.com to download the latest version of the device data sheet). Note that this change notification only applies to TPS2549-Q1.

Important

TI has **fixed** the CDP/SDP auto-switch bug in all TPS2549-Q1 devices manufactured **after Feb 29th, 2016**.

The CDP/SDP auto-switch bug only affects TPS2549-Q1 parts that were manufactured **before** March 1st, 2016. Customers can easily verify if the part they are using is affected by this bug, by inspecting the top-side marking on the part.

```
+-----+
!0      !
! 2549Q !
! TI 63* !
! ****  !
+-----+
```

Parts that have the bug fixed will have date code 63* or higher (that is, 64, 6A, 71, and so forth). In the highlighted alphanumeric character, the first character represents the year of manufacture, hence 6 is year 2016 and a 7 would be year 2017 and so on. The second character is a HEX for the month (1=January, 2=February, ... , A=October, B=November, and so forth).

When in doubt, contact your local TI sales office. Contact your local TI sales office if you have a device with a date code prior to 63*, that is, 62* or earlier.

Silicon Bug Description: CDP/SDP Auto-Switch Function is Incorrectly Occurring in CDP Mode

Description: Refer to the device truth table ([Table 1](#)) and Section 8.3.6 in the TPS2549-Q1 data sheet ([SLUSCE3](#)), there is a CDP/SDP auto-switch function in CDP mode to support some popular phones that do not comply with the BC1.2 specification because they fail to establish a data communication in CDP mode. The CDP/SDP scheme performs the following:

1. The TPS2549-Q1 determines when a noncompliant phone has wrongly classified a CDP port as DCP port and has not made a data connection
2. The TPS2549-Q1 switches to SDP mode automatically after a VBUS discharge event so that the non-compliant phone can see a connection to SDP and make data connection
3. The TPS2549-Q1 switches back to CDP mode automatically without VBUS discharge so that the non-compliant phone is not interrupted while the port is ready in CDP mode, if a new device is attached.

The CDP/SDP auto-switch function in TPS2549-Q1 is meant to occur when a portable device never signals connection and enumerates. However, the silicon bug discovered makes the CDP/SDP auto-switch function incorrectly occur after a portable device has successfully established data communication as [Table 1](#) shows.

Table 1. Truth Table

CTL1	CTL2	CTL3	CURRENT LIMIT SETTING	MODE	STATUS OUTPUT (ACTIVE-LOW)	FAULT OUTPUT (ACTIVE-LOW)	CS FOR CABLE COMPENSATION	NOTES
0	0	0	Lo	DCP ⁽¹⁾	OFF	ON ⁽²⁾	ON	DCP includes divider 3, 1.2-V mode, and BC1.2 mode
0	0	1	Hi	DCP ⁽¹⁾	ON	ON	ON	DCP includes divider 3, 1.2-V mode, and BC1.2 mode
0	1	X	Lo	SDP	OFF	ON	ON	Standard SDP port
1	0	X	NA	Client mode	OFF	OFF	OFF	No current limit, power switch disabled, data switch bypassed
1	1	0	Lo	SDP ⁽³⁾	OFF	ON ⁽²⁾	ON	Standard SDP port
1	1	1	Hi	CDP ⁽³⁾	ON	ON	ON	CDP-SDP auto switch mode

(1) No OUT discharge when changing between 000 and 001

(2) FAULT not asserted on overcurrent

(3) No OUT discharge when changing between 110 and 111

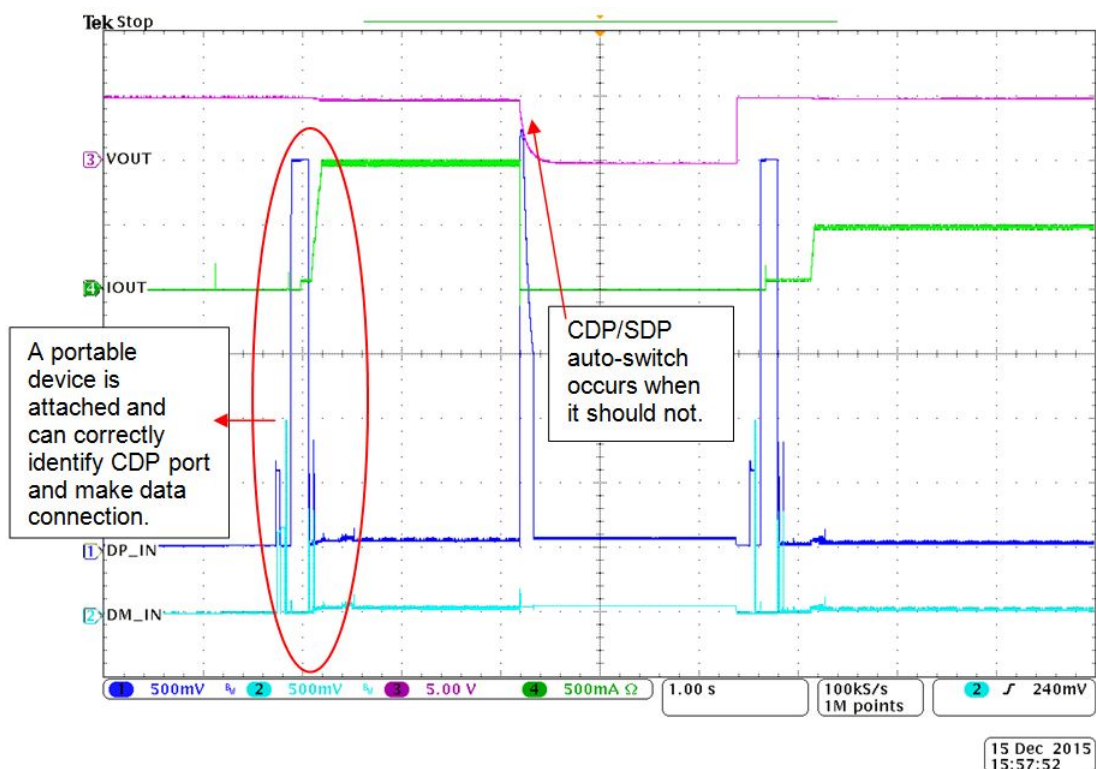


Figure 1. CDP/SDP Auto-Switch Occurs Incorrectly

Application Impact:

The CDP/SDP auto-switch bug will disable fast charging when the TPS2549-Q1 is configured in CDP mode. The bug prevents the portable device from fast charge as the TPS2549-Q1 switches to SDP mode and may also result in data communication loss due to VBUS discharge as shown in [Figure 1](#).

Work Around:

Unfortunately there is no work around where fast charge and data communication are needed in same mode. Use DCP mode to fast charge the device if data communication is not needed, or SDP mode for data communication if fast charging is not needed.

Resolution:

TI has fixed the CDP/SDP auto-switch bug in silicon, see the first page of this change notification for details.

Impacted Device:

Device	Package	Top-Side Marking
TPS2549-Q1	QFN16	2549Q

IMPORTANT NOTICE

Texas Instruments Incorporated and its subsidiaries (TI) reserve the right to make corrections, enhancements, improvements and other changes to its semiconductor products and services per JESD46, latest issue, and to discontinue any product or service per JESD48, latest issue. Buyers should obtain the latest relevant information before placing orders and should verify that such information is current and complete. All semiconductor products (also referred to herein as "components") are sold subject to TI's terms and conditions of sale supplied at the time of order acknowledgment.

TI warrants performance of its components to the specifications applicable at the time of sale, in accordance with the warranty in TI's terms and conditions of sale of semiconductor products. Testing and other quality control techniques are used to the extent TI deems necessary to support this warranty. Except where mandated by applicable law, testing of all parameters of each component is not necessarily performed.

TI assumes no liability for applications assistance or the design of Buyers' products. Buyers are responsible for their products and applications using TI components. To minimize the risks associated with Buyers' products and applications, Buyers should provide adequate design and operating safeguards.

TI does not warrant or represent that any license, either express or implied, is granted under any patent right, copyright, mask work right, or other intellectual property right relating to any combination, machine, or process in which TI components or services are used. Information published by TI regarding third-party products or services does not constitute a license to use such products or services or a warranty or endorsement thereof. Use of such information may require a license from a third party under the patents or other intellectual property of the third party, or a license from TI under the patents or other intellectual property of TI.

Reproduction of significant portions of TI information in TI data books or data sheets is permissible only if reproduction is without alteration and is accompanied by all associated warranties, conditions, limitations, and notices. TI is not responsible or liable for such altered documentation. Information of third parties may be subject to additional restrictions.

Resale of TI components or services with statements different from or beyond the parameters stated by TI for that component or service voids all express and any implied warranties for the associated TI component or service and is an unfair and deceptive business practice. TI is not responsible or liable for any such statements.

Buyer acknowledges and agrees that it is solely responsible for compliance with all legal, regulatory and safety-related requirements concerning its products, and any use of TI components in its applications, notwithstanding any applications-related information or support that may be provided by TI. Buyer represents and agrees that it has all the necessary expertise to create and implement safeguards which anticipate dangerous consequences of failures, monitor failures and their consequences, lessen the likelihood of failures that might cause harm and take appropriate remedial actions. Buyer will fully indemnify TI and its representatives against any damages arising out of the use of any TI components in safety-critical applications.

In some cases, TI components may be promoted specifically to facilitate safety-related applications. With such components, TI's goal is to help enable customers to design and create their own end-product solutions that meet applicable functional safety standards and requirements. Nonetheless, such components are subject to these terms.

No TI components are authorized for use in FDA Class III (or similar life-critical medical equipment) unless authorized officers of the parties have executed a special agreement specifically governing such use.

Only those TI components which TI has specifically designated as military grade or "enhanced plastic" are designed and intended for use in military/aerospace applications or environments. Buyer acknowledges and agrees that any military or aerospace use of TI components which have **not** been so designated is solely at the Buyer's risk, and that Buyer is solely responsible for compliance with all legal and regulatory requirements in connection with such use.

TI has specifically designated certain components as meeting ISO/TS16949 requirements, mainly for automotive use. In any case of use of non-designated products, TI will not be responsible for any failure to meet ISO/TS16949.

Products

Audio	www.ti.com/audio
Amplifiers	amplifier.ti.com
Data Converters	dataconverter.ti.com
DLP® Products	www.dlp.com
DSP	dsp.ti.com
Clocks and Timers	www.ti.com/clocks
Interface	interface.ti.com
Logic	logic.ti.com
Power Mgmt	power.ti.com
Microcontrollers	microcontroller.ti.com
RFID	www.ti-rfid.com
OMAP Applications Processors	www.ti.com/omap
Wireless Connectivity	www.ti.com/wirelessconnectivity

Applications

Automotive and Transportation	www.ti.com/automotive
Communications and Telecom	www.ti.com/communications
Computers and Peripherals	www.ti.com/computers
Consumer Electronics	www.ti.com/consumer-apps
Energy and Lighting	www.ti.com/energy
Industrial	www.ti.com/industrial
Medical	www.ti.com/medical
Security	www.ti.com/security
Space, Avionics and Defense	www.ti.com/space-avionics-defense
Video and Imaging	www.ti.com/video

TI E2E Community

e2e.ti.com