

Overview Using Linear Hall Effect Sensors to Measure Angle

Ross Eisenbeis and Mitch Morse, Magnetic Sensing Products



Many mechanical systems have a need to measure rotational angle. This is common for simple rotating components such as motors, wheels, knobs, and valves.



Figure 1. Butterfly Valve

Angle information can also describe *linear displacement*. Figure 2 shows a simple construction using a hinge and lever that move in an arc.

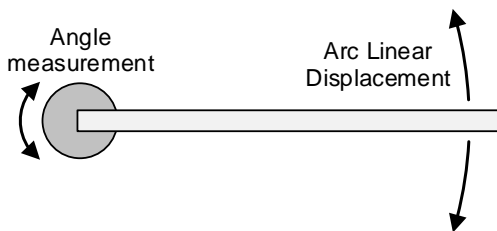


Figure 2. Linear Displacement in an Arc

Fluid level can be measured if a float is attached, as shown in Figure 3.

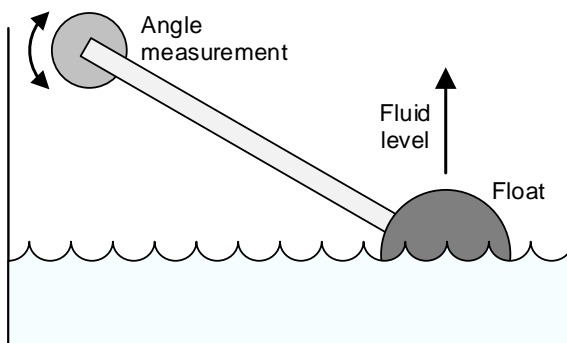


Figure 3. Fluid Level Described By Angle

Some applications require measuring a true straight-line linear displacement. This can be achieved with an additional joint between two rigid bars, as shown in Figure 4.

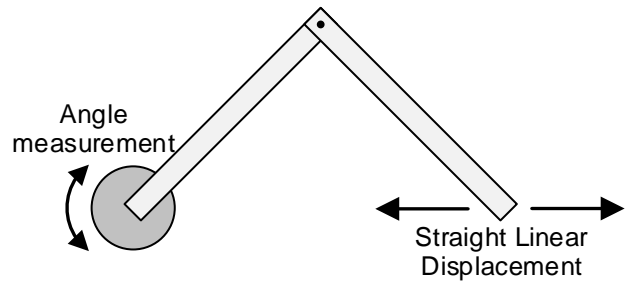


Figure 4. Linear Displacement in a Straight Line

In every case, the angle sensor measures the number of degrees the hinge is rotated. It does not require memory, and the sensor can be powered off between measurements.

The Magnet

In order to magnetically sense the rotational angle of a hinge, a 2-pole diametrically-magnetized magnet must be attached to it, such as the one shown in Figure 5.

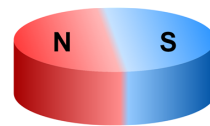


Figure 5. Diametrically-Magnetized Cylinder

The most commonly used magnet material is Neodymium-Iron-Boron (NdFeB), since it produces the strongest field for its size. Ceramic ferrite magnets are also used, but generate about 30% of the field of NdFeB, which means either the sensor will receive a weaker field, or a closer sensing distance must be used, or the magnet must be sized larger. For high temperature environments, Samarium-Cobalt is best suited.

Using Linear Hall Effect Sensors

Linear Hall effect sensors like the [DRV5055-Q1](#) measure the magnetic flux density vector component that enters the face of the package and output a linearly proportional signal. As the magnet in [Figure 5](#) rotates, it produces a sinusoidal variation in magnetic flux density at every point in space around it, in 2 or 3 of the axes. Therefore, a linear Hall sensor that is placed nearby will produce a sine wave output as the magnet turns, as shown in [Figure 6](#).

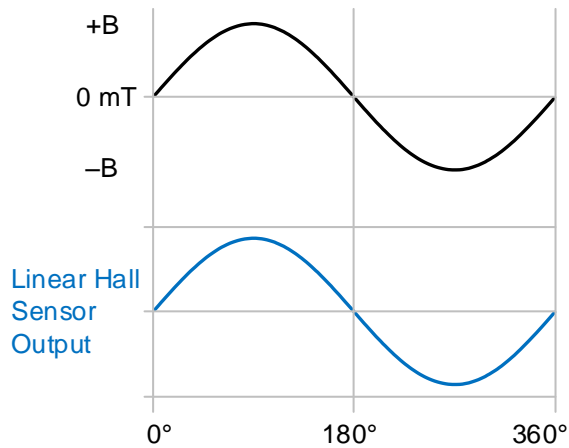


Figure 6. Output from One Linear Hall Sensor

When one linear Hall sensor is used, the range of unique output spans from 90° to 270°, and the magnet must be properly aligned during component assembly. These shortcomings are eliminated when two linear Hall sensors are used with a 90° phase offset to produce sine and cosine waveforms, as shown in [Figure 7](#).

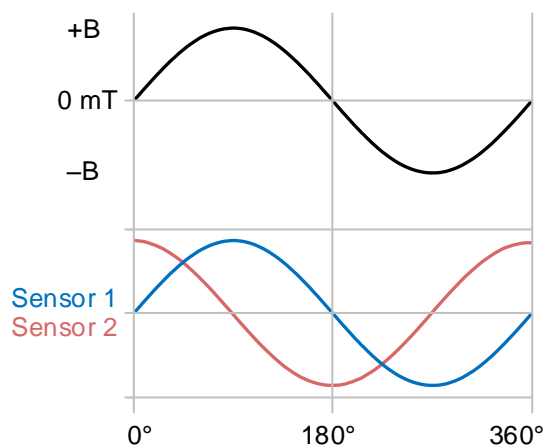


Figure 7. Output from Two Linear Hall Sensors

To create this 90° phase offset, the two sensors can be placed in a 90° arc across the magnet. [Figure 8](#) shows this for each [DRV5055-Q1](#) package option.

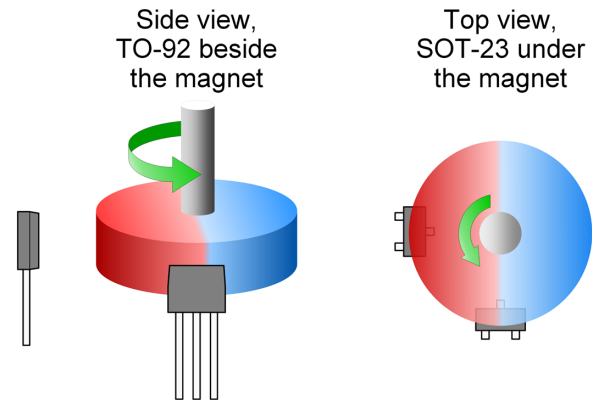


Figure 8. Sensor Placement Examples

For more details on how to measure angles with linear Hall effect sensors, see the [Linear Hall Effect Sensor Angle Measurement Theory, Implementation, and Calibration](#) application report. For a hands-on example, see the [DRV5055 angle evaluation module](#).

The [DRV5055-Q1](#) provides design flexibility in multiple package options, 3.3-V and 5-V support, and multiple sensitivity options. A fast 20-kHz sensing bandwidth and low-noise output delivers a high-performance and cost-effective angle-sensing solution.

Table 1. Alternative Device Recommendations

Device	Optimized Parameters	Performance Trade-Off
DRV5055	Non-Automotive Grade	125°C Max Temperature
DRV5057	2-kHz PWM Output with Noise Immunity	Lower Sensing Bandwidth
DRV5053, DRV5053-Q1	Higher Voltage: 2.5 V to 38 V	Sensitivity $\pm 10\%$ Over Temperature
DRV5056, DRV5056-Q1	Higher Gain Options	Limited Angle Measurement Range (Unipolar)

Table 2. Other Resources

Resource	Description
SBOA200	Incremental Rotary Encoder Design Considerations
SBOA196	Power Gating Systems with Magnetic Sensors
SLYA036	Linear Hall Effect Sensor Angle Measurement Theory, Implementation, and Calibration
DRV5055-ANGLE-EVM	Angle Measurement Evaluation Module Using Two DRV5055s

IMPORTANT NOTICE AND DISCLAIMER

TI PROVIDES TECHNICAL AND RELIABILITY DATA (INCLUDING DATASHEETS), DESIGN RESOURCES (INCLUDING REFERENCE DESIGNS), APPLICATION OR OTHER DESIGN ADVICE, WEB TOOLS, SAFETY INFORMATION, AND OTHER RESOURCES "AS IS" AND WITH ALL FAULTS, AND DISCLAIMS ALL WARRANTIES, EXPRESS AND IMPLIED, INCLUDING WITHOUT LIMITATION ANY IMPLIED WARRANTIES OF MERCHANTABILITY, FITNESS FOR A PARTICULAR PURPOSE OR NON-INFRINGEMENT OF THIRD PARTY INTELLECTUAL PROPERTY RIGHTS.

These resources are intended for skilled developers designing with TI products. You are solely responsible for (1) selecting the appropriate TI products for your application, (2) designing, validating and testing your application, and (3) ensuring your application meets applicable standards, and any other safety, security, or other requirements. These resources are subject to change without notice. TI grants you permission to use these resources only for development of an application that uses the TI products described in the resource. Other reproduction and display of these resources is prohibited. No license is granted to any other TI intellectual property right or to any third party intellectual property right. TI disclaims responsibility for, and you will fully indemnify TI and its representatives against, any claims, damages, costs, losses, and liabilities arising out of your use of these resources.

TI's products are provided subject to TI's Terms of Sale (www.ti.com/legal/termsofsale.html) or other applicable terms available either on ti.com or provided in conjunction with such TI products. TI's provision of these resources does not expand or otherwise alter TI's applicable warranties or warranty disclaimers for TI products.

Mailing Address: Texas Instruments, Post Office Box 655303, Dallas, Texas 75265
Copyright © 2019, Texas Instruments Incorporated